

Halifax, Jan. 28th, 1918

TO WHOM IT MAY CONCERN

I hereby certify that I have examined the Common School on Bloomfield Street, Halifax, since the explosion of the 6th December 1917, and I find the building above basement walls practically destroyed.

In my opinion, the total damage and loss sustained in connection with the said building, by reason of the said explosion is thirty-seven thousand five hundred dollars. (\$37,500)

(Sgd.) W. T. Horton

COPY

Halifax,
Jan. 28th, 1918

TO WHOM IT MAY CONCERN-

I hereby certify that I examined Richmond School, Roome Street, Halifax, since the explosion on the 6th of December 1917, and find the building collapsed and is a total loss.

In my opinion, the total damage and loss sustained in connection with the said building by reason of the said explosion is sixty-eight thousand nine hundred dollars (\$68,900)

(Sgd.) W. T. Horton

Halifax, Jan 1st, 1918

To City Engineer

Halifax, N. S.

Sir,

I have the honor to report the condition I found the houses on West Young Street, north end. I have gone over every part of the houses as far as I have gone, and if possible to put in good repair, I have tried to do so and when I came to houses that were blown to pieces badly, I marked them "Condemned" for your approval.

I have the honour to be, Sir,

Your obedient servant

(Sgd.) Harry L. Gates

137 Spr. Garden Rd.

Halifax, Jan. 1st, 1918

Location of house #94 West Young Street

Condition - Two side walls out, front out and house badly damaged. Marked CONDEMNED

Location of house #92 West Young Street

Small shop all down, sides blown in and damaged beyond repair. Shed in back, down.

Location of house #90 West Young Street

This house not worth repairing; blown to pieces so could do nothing with it. Marked CONDEMNED

Location of house #36 West Young Street

Found this house in very bad shape; walls and floor all torn to pieces and roof not worth repairing. Marked it CONDEMNED

(Sgd.) Harry L Gates

House no. 98 West Young Street - Owner John Quinn, #61 Bilby St

Outside in fair condition.
Repairs necessary-

Ell -	1 sqr. shingles	\$8.00
	100' boarding	3.00
Back -	1 sqr. shingles	8.00
	back sill new	50.00
	1 down spout	4.00
Front -	2 sqr. shingles	16.00
	200' boarding	7.00
	100' - 2 X 4	3.50
	7 cellar window frames and sashes	
	24 X 26	35.00
Front steps-	5 risers 5 treads	10.00
	50' - 2 X 10 for steps	2.00
	10'10" pine	2.00
	Labour	12.00
Roofing -	2 sqr. tar and gravel	16.00
Inside finish	3 frames and sashes glazed	45.00
	4 doors @ \$15	60.00
	Front room ceiling repaired	25.00
	3 pr. sashes 15 X 32 @ \$5	15.00
	2 frames and sashes	30.00
	2 doors @ \$15	30.00
	1 set sliding door 7'6" X 8' opening	
	leasing and frame for same	30.00
	4 sqr. shingles	32.00
	400' boarding	12.00
	2 front doors @ \$20	40.00
	Stairs repaired	25.00
Plastering	575 yds. @ \$60	345.00
Chimney	2 4 flue @ \$6 per ft.	300.00
Foundation repaired		75.00

Total cost \$1240.00

(Sgd.) Harry L Gates

RECONSTRUCTION--HALIFAX, N. S.

REPORT NO. 334

.....John.....Street. No. 193 Tenant.....
 Owner John Nabreca John..... Address, No. 195 Brunswick.....St.
 Class of building Wood..... Building used for Welding.....
 Approximate size of lot—Frontage.....ft. Depth.....ft. Area.....sq. ft.
 Approximate size of bldg.—Front 40...ft. Depth 30...ft. Stories 2... Height 20 ft
 Size of extension..... Front 12..... Depth 20..... Stories 1..... Height 10 ft
 Assessed value before explosion—Land..... Buildings.....
 Estimated value before explosion \$ 3,800 Estimated cost of permanent repairs \$ 1,927.00

ESTIMATED COST

Foundations.....	1,335.00
Chimneys.....	149.00
Fireplaces.....	18.00
Concrete floors	47.00
Lath and plastering.....	825.00
Exterior walls and coverings.....	128.00
Interior walls and finish.....	
Roof—framing and covering.....	105.00
Windows—frames, sashes, glazing.....	64.00
Doors—frames, etc.....	56.00
Stairs and trim.....	
Painting.....	155.00
Papering.....	90.00
Plumbing.....	135.00
Gas pipes and fittings.....	
Miscellaneous.....	

1,927.00

Remarks :

City Engineer's Office.

LIST OF BUILDINGS REPORTED AS BEING DANGEROUS FIRE RISKS OWING
TO ACCUMULATION OF RUBBISH IN BASEMENTS - WEEK ENDING
MARCH 18th

41 A	Shirley Street	45	Shirley Street
53	" "	43	Pepperell "
45	Pepperell "	42	Quinpool Road
134	Quinpool Road	82 1/2	" "
32	Louisburg Street	40	Louisburg Street
17	" "	115	Maynard "
3 & 5	Falkland "	167	Hollis
159	Hollis	157	" "
147	" "	141-3	" "
135	" "	89	" "
87	" "	163	" "
164	" "	166	Granville
160	Granville	156	" "
134	" "	132	" "
124-6	" "	96	" "
82	" "	76-8	" "
40	" "	73	" "
115	" "	139	" "
141	" "	165-7	" "
43	Barrington	52	Barrington
78-80	" "	88	" "
119-23	" "	127	" "
220	Argyle	158-62	Argyle
136	" "	108	Grafton
37-9	Brunswick		

WEEK ENDING MARCH 25

36	Kaye Street	43	Almon Street
28-30	Duke "	7	George "
37	Sackville	9	" "
90	" (Roy Bldg.)		Argyle (Strand Theatre)
16	Lawrence	51	Lawrence
110	" "	55	" "
50	Allen	1 1/2	Harvard
50 to 11	Louisburg	39 1/2	" "
			Beech St. (J.H.Mullens)

City Engineer's Office.

WEEK ENDING APRIL 1ST

44	Duncan Street	60	Duncan Street
46	" "	76	" "
42	" "	64	" "
141	North "	95	Duncan "

WEEK ENDING APRIL 5TH

290	Pleasant Street	26	Green Street
120	" "	28	" "
17	Smith "	12	South "
631	Robie "	49	" "
36	Kaye "	132	Robie "
2	Williams "	190	" "
		218	" "

GLASS FOR EXTERNAL WINDOWS
CITY HALL

(This list includes no transom lights)

201	22 X 48 ✓
15	18 X 42
10	18 X 38 ✓ 91 hrs
5	24 X 38 ✓
5	18 X 36
4	18 X 38 91 hrs
13	24 X 36
13	24 X 48 ✓
45	22 X 42 ✓
5	24 X 42

Board of Control.

OFFICE OF CITY CLERK,
CITY CLERK

Halifax, N. S., January 8th, 1918.



Extract from Minutes of a Meeting of the Board of Control of the City of Halifax,
held on the 2nd day of January 1918.

INSPECTION OF DAMAGE TO CITY PROPERTY.

The Acting City Engineer is authorized and instructed to employ a sufficient staff of qualified persons to inspect and report upon the damage done to all City property, including school buildings, and to submit an estimate of the cost of repairs.

A true extract.

City Clerk.

City Engineer.

Handwritten notes:
The Board
of Control
has approved
the report of
the City Engineer
of 1/8/18

DAMAGE TO CITY WORKSHOPS

2 truss top and bottom chord broken
7 " do.
2 " badly sprung
20 windows sashes broken top and bottom 14 X 16 glass - two
sashes - 6 glass to sash
3 large doors broken
5 bottom sashes broken
5 windows both sashes broken
1 large door broken
2 trusses damaged
20 windows both sashes broken

office

1 top sash
5 windows both sashes broken

Plumbers room

3 windows, both sashes broken
1 door broken
Partition smashed three feet wide

Living quarters

6 single sashes broken
19 windows broken both sashes
1 single door

Ash cart shed

Roof doors and windows smashed (roof down)

Barn

20 windows broken, both sashes
9 single sashes
3 trusses sagged

99 - 14 X 16 glass in different
parts of the building.

Halifax N.S. Dec 14 1921
City Rooms

Mr J Jones
City Controller





The Amount of glass required is

130 panes	10 x 15
36 panes	10 x 17
97 panes	14 x 26
45 panes	14 x 28
132 panes	14 x 18
15 panes	14 x 15
60 panes	12 x 20
184 panes	14 x 30
103 panes	14 x 17
15 panes	14 x 20
48 panes	16 x 20

we will require 58 Pair of Sashes
100 Window frame to be repaired
4 doors to be repaired

200 sq. feet of Plaster is down

John H Grant Eng.

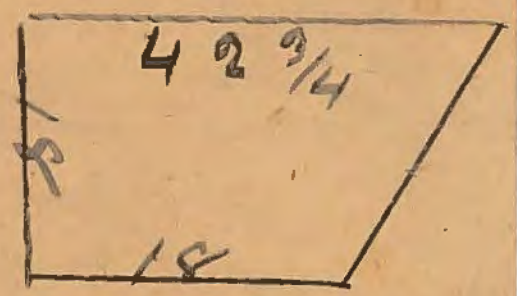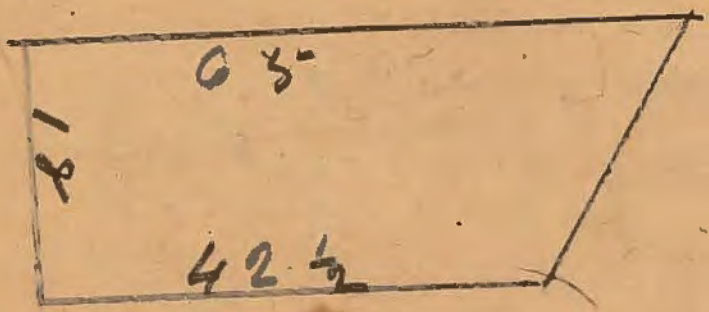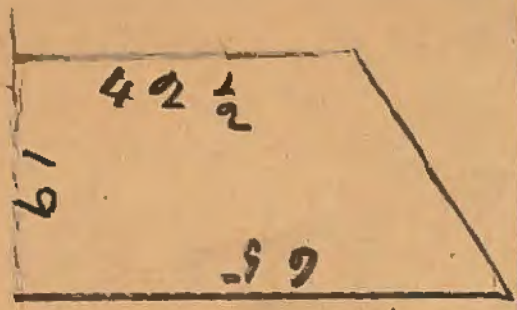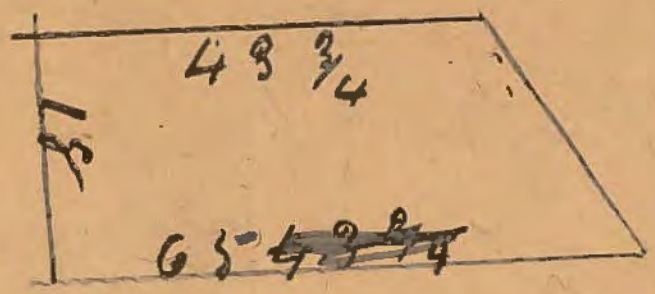

Blaw for Sky Light

ESTIMATE OF DAMAGE TO
BLOOMFIELD HIGH SCHOOL
BLOOMFIELD STREET.

BRICKWORK	Brickwork & pointing same	\$ 2800.00
SLATING	Slating roof 90 sqs.	1970.00
	Scaffolding	800.00
PLASTERING	Plastering ceilings & walls	4700.00
	Repairing metal lathing	1300.00
	Slate blackboards	n500.00
	Deafening	500.00
CARPENTER WORK	Straightening partitions	900.00
	Repairs to roof framing, trusses, dormer windows etc.	2200.00
	Repairs to hardwood floors 200 sqs.	3000.00
	20 New doors, repairs to doors, architraves, vestibules, & transoms and fanlights.	1150.00
	New sashes, repairs to frames, transoms, parting strips, steps, winter sashes & hardware.	690.00
	repairs to skirting, dado, picture molding, capping etc.	550.00
plumbing	Plumbing. 10 W.Cs. 14 Urinals, soil & water pipes	2000.00
	Vent ejectors & metal vent shafts	1600.00
	Outside metal work.	1200.00
	Composition roofing	600.00
GLAZING & PAINTING	Glazing	2450.00
	Refinishing, Varnishing wood work & painting sashes.	3300.00
Heating & Ventilation	Jacket heater & fitting valves etc.	400.00
	Powers Regulator disks. thermostatic valves etc.	475.00
HEATING & ELECTRIC WORK	Electric lights, wire & bells.	400.00
		\$ -----
		33485.00
		10% 3348.00
		\$ -----
		36833.00

H. J. Busch
Architect

Feb 5th 1918

ESTIMATE OF DAMAGE TO
CHEBUCTO ROAD SCHOOL
CHEBUCTO ROAD.

BRICKWORK	Brickwork Face brick.	\$ 2000.00
	Painting brick and stone work round windows	2000.00
	Scaffolding	900.00
	Slatting	3225.00
PLASTERING	Plastering	3000.00
	Deafening	500.00
	Blackboards resetting etc.	440.00
CARPENTER WORK	Roof framing, trusses boarding	1700.00
	Trusses 2nd. floor ceilings	700.00
	straightening and rebuilding inside partitions	880.00
	Rebuilding floors of assembly hall	810.00
	200 sqs. maple flooring, renewing scraping etc.	2600.00
	Spruce dado picture molding, chalk rails blackboards, capping	450.00
	New sashes, transoms winter sashes, repairs, cords, steps parting strips etc.	1050.00
	Outside and vestibule doors	360.00
	New inside doors, repairs to doors, transoms fanlights & hardware	1070.00
	Skylight and inside sash	50.00
	Repairs to seats	60.00
	Metal ceilings, renailing etc.	800.00
	Repairs to outside cornice	200.00
GLAZING & PAINTING	Glazing sashes	2635.00
	Painting sashes and cornice	350.00
	Painting walls and ceilings	1950.00
	Refinishing & varnishing wood work	592.00
	Cleaning and ciling floors	430.00
PLUMBING	Repairs to ventilators, copper work	1250.00
	W.Cs. urinals, traps water & soil pipes, valves, drinking fountains, wash basinsets.	2600.00
	Composition roof	320.00
HEATING & VENTILATION	Ventilation shafts	1350.00
	Radiators valves, elbows & pipes	500.00
ELECTRIC WORK	Electric wires, fixtures bells etc.	\$ 800.00

		35772.00
		3578.00

		\$ 39 350.00

H. J. Busch
Architect

Feb 5th 1918

ESTIMATE OF DAMAGE TO
TOWER ROAD SCHOOL
TOWER ROAD.

BRICKWORK.	Pointing brick and stone work, round windows and door frames.	\$ 1200. ⁰⁰
	Scaffolding.	900. ⁰⁰
PLASTERING	Plastering	60. ⁰⁰
	Slatting and repairs to copper flashings, ventilator ejectors	45. ⁰⁰
CARPENTER WORK	New sashes, repairs to sashes, transoms, fan lights, winter sashes, glass partitions dormer windows	460. ⁰⁰
	Repairs to doors, frames, architraves front and side entrances	185. ⁰⁰
GLAZING & PAINTING	Glass replaced 300 " to be " 650	950. ⁰⁰
	Painting outside sashes 290 refinishing and varnishing inside woodwork 350	640. ⁰⁰
PLUMBING	1 Jacket heater 150 Water pipes gate valves, 1 toilet, basin trap, fitter, drinking fountain head, local vents to W.C. flush tank to urinal, traps etc.	572. ⁰⁰
HEATING	2 Damper control radiators, 1 Durham trap, pipes and labor.	620. ⁰⁰
		\$ 5632
	10 %	563
		\$ 6195

H. J. Busch
Architect

ESTIMATE OF DAMAGE TO
ST JOSEPH GIRLS SCHOOL
KAY STREET.

MASON WORK	Foundation walls & chimneys	\$ 2100.00
	Press brick	660.00
	Concrete floor 600 yds.	1200.00
	Deafening floors	600.00
PLASTERING	Plastering arches and cornices.	2295.00
	Blackboards	950.00
CARPENTER WORK	Framing	3982.00
	Trusses and beams	1916.00
	Deafening	275.00
	Bridging	119.00
	Bearding walls and roof	870.00
	Shingling, tarred paper, walls and roof	1000.00
	Outside finish	800.00
	Window frames and sashes	3286.00
	Entrances	430.00
	Flagstaff skylights lining	135.00
	Strapping arches etc.	610.00
	Metal ceilings and bearding	1420.00
	Floors	2228.00
	Inside doors and finish	1050.00
	Skirting	540.00
	Inside staircase	1200.00
	Platforms and seats	180.00
	Chalk shelves, Blackboards, & Picture molding	425.00
	Coat hooks and battens	60.00
	W.C. Partitions, pipes etc.	220.00
	Tank room in attic	80.00
	Composition roof 30 sqs.	360.00
PAINTING & GLAZING	Glazing	665.00
	Painting exterior walls, dipping shingles, paint exterior woodwork	500.00 1500.00
PLUMBING	Plumbing work, outside, flashing, zinc & copper	1170.00
	10 W.C.s.	1200.00
	Water and soil pipes	800.00
	Ventilation pipes & ejectors	600.00
	Wash basins and drinking fountains	180.00
HEATING	Heating apparatus	\$ 6000.00

		41727.00

		45900.00

ESTIMATE OF DAMAGE TO
ALEXANDER MCKAY SCHOOL
GOTTINGEN STREET.

TILES	Tile partitions 15000 @ 38cts	\$ 5200.00
PLASTERING	Plaster ceilings 2000 yds @ 60¢	1200.00
	Plaster walls 3000 " @ 50¢	1500.00
	Cornices	300.00
	Metal lathing 18000 sq. ft. @ 14¢	2520.00
	Slate Blackboards 1200 sq.ft.	600.00
	Linoleum	280.00
	Repairs to stair cases	50.00
	Repairs to roof	100.00
	Cleaning brick walls	200.00
	Brick work on boilers & furnace doors	50.00
CARPENTER WORK.	Window frames, sashes, steps, sills, winter sashes & hardware	1680.00
	5 Entrances	375.00
	Fences	250.00
	Relaying, scraping 140 sqs. maple floor	1800.00
	Arch template & pilasters Assembly stage	90.00
	Battens heating coils	30.00
	3 pairs vestibule doors, frames, fanlights.	225.00
	Inside doors, frames, architraves, fanlights.	1250.00
	9 Door frames, 1 pair single doors basement.	125.00
	5 Lavatory doors & fronts.	100.00
	Stud partition sheathed both sides & W.C. partition.	245.00
	Base, burlap cap, chalk shelf, picture molding.	800.00
	Wall handrail main stair.	25.00
	Library bookcases.	75.00
	10 Bookcases in class rooms.	300.00
	10 Peles, hooks, umbrella holders.	300.00
	2 Strip hook umbrella holders Teachers room.	10.00
	Damage to 12 seats.	60.00
	2 Lavatory partitions, Teachers room.	60.00
GLAZING & PAINTING	Glazing	2000.00
	Burlap & painting,	1200.00
	Refinishing hardwood.	350.00
	Oiling floors.	300.00
	Painting sashes 160 windows @ \$ 2.00	320.00
ELECTRIC WORK	Electric conduits & wires.	800.00
METAL WORK.	Copper cornice & ventilator ejectors.	2800.00
	Galvanized iron vent shafts.	1800.00
	Staging.	800.00
		\$-----
		30170.00
		3017.00
		\$-----
		33187.00

10%

H. J. Busch
Architect

Feb 5th 1918

ESTIMATE FOR

JOSEPH HOWE SCHOOL

CREIGHTON STREET.

BRICKWORK	Brickwork, granite, pointing same etc.	\$ 2960 .00
SLATING	Slating reef etc.	1970 .00
PLASTERING	Plastering, deafening, blackbeards & resetting same	3641 .00
CARPENTER & JOINER WORK	Reef frame, bearding, floor joists, straightening up rafters etc.	1300 .00
	New trusses, new joists & ceilings, straightening partitions, new floors, dado & picture moldings etc.	6940 .00
	New sashes & transoms also winter sashes & repairs to same, steps beads, cords etc.	600 .00
	Outside & inside door frames & sashes & repairs to same	900 .00
	Skylights etc. repairs to metal ceilings & re-nailing same	1108 .00
	Scaffolding	1500 .00
PAINTING & GLAZING	Glass for windows, doors, skylights etc.	991 .00
	Painting walls ceilings & doors also outside painting, window sashes, ceiling floors etc.	3212 .00
PLUMBING	Composition reef	456 .00
	Plumbing outside & inside, W.C'S, Urinals pipes etc.	6900 .00
HEATING & VENTILATION	Vent pipes Radiators, Valves etc.	2800 .00
ELECTRIC WORK	Electric wires & fixtures, bells etc.	600 .00

		35878 .00
		3587 .00

		39465 .00

H. J. Busch
Architect

Feb 5th 1918

ESTIMATE OF DAMAGE TO

ALEXANDRA SCHOOL

BRUNSWICK STREET.

BRICKWORK

Taking down two chimneys & rebuilding one	\$ 375
Pointing brickwork on walls & round windows doors etc.	1800
Scaffolding	900
Taking down and rebuilding south wall out of plumb 2½ inches, north wall out of plumb 1 inch.	3600
Slating and copper flashing at eaves.	1025
Composition roof	650

PLASTERING

Plastering 3320 sq. yds.	2822
Blackbeards moldings etc.	2550

CARPENTER WORK

Roof frame, boarding, repairs to flat roof cornice etc.	485
Sashes and repairs, parting slips, steps, transom sashes etc.	658
New doors and repairs.	366
Taking down, replacing and supporting ceilings in class rooms	570
Trusses and attic floor	250

PAINTING & GLAZING

Glazing.	759
Painting inside walls and outside sashes refinishing woodwork & 3 class room ceilings	2910

PLUMBING WORK

Plumbing work frozen	
W.C. tanks valves etc	2000
Urinals tanks & valves	300
Water and soil pipes, traps etc.	850

HEATING

Radiators, valves, etc.	800
-------------------------	-----

\$	-----
	23670
10%	2367
\$	-----
	26037

H. J. Busch
Architect

Feb 5th 1918

Feb. 6, 1918

H. W. Johnston Esq.,
Acting City Engineer

Sir,

I beg to report that the following city buildings have been examined and estimates made of the damage done to them by the explosion on Dec. 6th, as follows-

City Hall	\$11,216.00
City Prison	10,637.00
City Home	10,107.00
Abattoir	4,227.00
Reservoir	226.00
Small Pox Hospital	2,200.00
576-578 Barrington St. (Outhit)	958.00
Acadian School Bldg.	770.00
Cor. Market & George (tenement)	637.00
114 Longard Rd.	2,486.00
116 " "	1,433.00
City Workshops	4,902.00
City Market	14,253.00
Town Clock	
Incinerator	2,995.00
Infectious Disease Hospital	
<u>FIRE DEPARTMENT</u>	
Bedford Row Engine house	1,400.00
Branswick St. " "	2,847.00
Quinpool Rd. " "	1,583.00
Morris St. " "	1,240.00
Gottingen St. " "	3,112.00
Spr. Garden Rd. " "	600.00
Grafton St. " "	586.00
West St. " "	4,303.00
Maynard St. (Isnor)	508.00
<u>SCHOOL PROPERTY</u>	
Alexander McKay	33,187.00
St. Joseph's Girls'	45,900.00
Tower Road	6,195.00
Chebucto Rd.	39,350.00
Bloomfield High	36,833.00
Alexandra	26,037.00
Joseph Howe	39,465.00
Quinpool Rd.	5,765.00
LeMarchant St.	3,940.00
Acadian School	850.00
County Academy	5,200.00
Bloomfield (Common)	37,500.00
St. Patrick's Girls' (Common)	7,650.00
Richmond	68,900.00
Morris St.	3,145.00
St. Patrick's Boys'	2,968.00
St. Mary's Girls'	1,510.00
St. Mary's Boys'	1,805.00
St. Patrick's Girls' (High Domestic Science	

Respectfully submitted

Asst. Bldg. Inspector

JOBING PROMPTLY ATTENDED TO.

Sizes of houses on Union, Sullivan & Agricola Sts.

House No.	Street	Front	Depth	Stories	Notes
4	Sullivan St	24	17	2	2 story
"	" 3	21	28	2	"
"	" 6	22	28	2	"
"	" 7	20	24	2	"
"	" 8	20	28	2	"
"	" 11	20	30	2	"
"	" 13	16	32	2	" Ell 9x16 2 story
"	35-7-37	40	26	2	double house 2 story
"	36-7-38	40	26	2	double house 2 story
"	12. 20	24		2	2 story shabby house.

Agricola No 296 front 18 x 22 2 story Ell 12x16 1 story 12 x 38 1 story
 (built on rear) (built on outside of main building)

House No.	Street	Front	Depth	Stories	Notes
14	Union St	22	18	2	2 story Ell 9x8 1 story
20	"	22	24	1	1 story + patch roof
26	"	18	26	2	"
28 and 30	"	30	26	2	2 story
34	"	18	40	2	2 story
36	"	22	40	2	"
62	"	20	38	2	"

ESTIMATE OF DAMAGE TO CHEBUCTO RD. SCHOOL

BRICKWORK		
Brick work		\$2000.00
Face brick		
Pointing brick and stone work around windows		2000.00
Scaffolding		900.00
Slating		3225.00
PLASTERING		
Plastering		3000.00
Deafening		500.00
Blackboards, resetting, etc.		440.00
CARPENTER WORK		
Roof framing, trusses, boarding		1700.00
Trusses, 2nd floor ceilings		700.00
Straightening and rebuilding inside partitions		880.00
Rebuilding floors of assembly hall		810.00
200 sqs. maple flooring, renewing, scraping, etc.		2600.00
Spruce dado picture molding, chalk rails blackboards, capping		450.00
New sashes, transoms, winter sashes, repairs, corks, stops, parting strips etc.		1050.00
Outside and vestibule doors		360.00
New inside doors, rep. to doors, transoms fanlights and hardware		1070.00
Skylight and inside sash		50.00
Repairs to seats		60.00
Metal ceilings, toenailing, etc.		800.00
Repairs to outside cornice		200.00
GLAZING AND PAINTING		
Glazing sashes		2635.00
Painting sashes and cornice		350.00
Painting walls and ceilings		1550.00
Refinishing and varnishing wood work		592.00
Cleaning and oiling floors		430.00
PLUMBING		
Rep. to ventilators, copper work		1250.00
W.C.'S urinals, traps, water and soil pipes, valves, drinking fountains wash basins, etc.		2600.00
Composition roof		320.00
HEATING AND VENTILATION		
Ventilation shafts		1350.00
Radiators, valves, elbows and pipes		500.00

BRICKWORK

Brickwork and pointing same \$2800.00

SLATING

Slating roof 90 sqrs. 1970.00
scaffolding 800.00

PLASTERING

Plastering ceilings and walls 4700.00
Repairing metal lathing 1300.00
Slate blackboards 500.00
Deafening 500.00

CARPENTER WORK

Straightening partitions 900.00
Rep. to roof framing, trusses, dormer windows, etc. 2200.00
Rep. to hard wood floors, 200 sqrs. 3000.00
20 new doors, rep. to doors, architraves, vestibules, ~~doors~~ transoms and fanlights 1150.00
New sashes, rep. to frames, transoms, parting strips, steps, winter sashes and hardware 690.00
Rep. to skirting, dado, picture moulding capping, etc. 550.00

PLUMBING

Plumbing 10 w.c.'s, 14 urinals, soil and water pipes 2000.00
Vent ejectors and metal vent shafts 1600.-0
Outside metal work 1200.00
Composition roofing 600.00

GLAZING AND PAINTING

Glazing 2450.00
Refinishing, varnishing woodwork and painting sashes 3300.00

HEATING AND VENTILATION

Jacket heater and fitting valves, etc. 400.00
Powers Regulator disks, thermostatic valves etc. 475.00

~~21766~~
~~22766~~

ELECTRIC WORK

Electric lights, wire and bells 400.00

\$33485.00
10% 3348.00

\$36833.00

Feb. 5, 1918

(Sgd.) W. J. Bush

ESTIMATE FOR JOSEPH HOWE SCHOOL

CREIGHTON STREET

BRICKWORK

Brickwork, granite, pointing same etc. \$2960.00

SLATING Slating roof etc. 1970.00

PLASTERING

Plastering, deafening, blackboards and re-
setting same 3641.00

CARPENTER AND JOINER WORK

Roof frame, boarding, floor joists, straight-
ening up rafters, etc. 1300.00

New trusses, new joists and ceilings, str-
aightening partitions, new floors, dado
and picture moldings etc. 6940.00

New sashes and transoms also winter sashes and
repairs to same; stop beads, cords, etc. 600.00

Outside and inside door frames and sashes
and repairs to same 900.00

Skylights etc., repairs to metal ceilings and
renailing same 1108.00

Scaffolding 1500.00

PAINTING AND GLAZING

Glass for windows, doors, skylights, etc. 991.00

Painting walls, ceilings and doors also out-
side painting, window sashes, oiling floors
etc. 3212.00

PLUMBING

Composition roof 456.00

Plumbing outside and inside, w.o's urinals
pipes, etc. 6900.00

HEATING AND VENTILATION

Vent pipes, radiators, etc. 2800.00

ELECTRIC WORK

Electric wires and fixtures, bells etc. 600.00

\$35,878.00

10%

3,587.00

\$39,465.00

Feb. 5, 1918

(Sgd.) W .J. Busch

ESTIMATE OF DAMAGE TO
ALEXANDER MOKAY SCHOOL ON
GOTTINGEN ST.

TILES

Tile partitions 15000 @ 34¢ \$5200.00

PLASTERING

Plaster ceilings 2000 yds @ 60¢ 1200.00
 " walls 3000 " 50¢ 1500.00
 Cornices 300.00
 Metal lathing 18000 sq. ft. @ 14¢ 2520.00
 Slate blackboards 1200 " " 600.00
 Linoleum 280.00
 Repairs to stair cases 50.00
 " " roof 100.00
 cleaning brick walls 200.00
 Brick work on boilers and furnace doors 50.00

CARPENTER WORK

Window frames, sashes, stops, sills, winter sashes 1680.00
 Hardward 375.00
 5 entrances 250.00
 Fences
 Relaying, scraping 140 sqs. maple floor 1800.00
 Arch template and pilasters Assembly stage 90.00
 Battens heating coils 30.00
 3 prs. vestibule doors, frames, fanlights 225.00
 Inside doors, frames, architraves, fanlights 1250.00
 9 door frames, 1 pr. single doors basement 125.00
 5 lavatory doors and fronts 100.00
 Stud partition sheathed both sides and w.o. partition 245.00
 Base, burlap cap, chalk shelf, picture molding 800.00
 Wall handrail main stair 25.00
 Library book-cases 75.00
 10 bookcases in class rooms 300.00
 10 poles, hooks, umbrella holders 300.00
 2 strip hook umbrella holders Teachers' room 10.00
 Damage to 12 seats 60.00
 2 lavatory partitions, teachers' room 60.00

GLAZING AND PAINTING

Glazing 2000.00
 Burlap and painting 1200.00
 Refinishing hardwood 350.00
 Oiling Floors 300.00
 Painting sashes 160 windows @ \$2 320.00

ELECTRIC WORK

Electric conduits and wires 800.00

METAL WORK

Copper cornice and ventilator ejectors 2800.00
 Galvanized iron vent shafts 1800.00
 Staging 800.00

\$30170.00

10%

3017.00

\$33187.00

Feb. 5, 1918

(Sgd.) W. J. Busch

ESTIMATE OF DAMAGE TO ST. JOSEPH'S GIRLS' SCHOOL

KAYE STREET

MASON WORK	
foundation walls and chimneys	\$2100
Press brick	660
concrete floor - 600 yds.	1200
Deafening floors	600
PLASTERING	
Plastering arches and cornices	2295
Blackboards	950
CARPENTER WORK	
Framing	3982
Trusses and beams	1916
Deafening	275
Bridging	119
Boarding walls and roof	870
Shingling, tarred paper, walls and roof	1000
Outside finish	800
Window frames and sashes	3286
Entrances	430
Flagstaff skylights lining	135
Strapping arches, etc.	610
Metal ceilings and boarding	1420
Floors	2228
Inside doors and finish	1050
Skirting	540
Inside staircase	1200
Platform and seats	180
Chalk shelves, blackboards and picture molding	426
Coat hooks and battens	60
W.C. Partitions, pipes, etc.	220
Tank room in attic	80.
Composition roof, 30 sqrs.	360
PAINTING AND GLAZING	
Glazing	665
Painting exterior walls, dipping shingles painting exterior woodwork	1600
PLUMBING	
Plumbing work, outside, flashing, zinc and copper	1170
10 w.o's	1200
Water and soil pipes	800
Ventilation pipes and ejectors	600
Wash basins and drinking fountains	180
HEATING	
Heating apparatus	<u>6000</u>

ESTIMATE OF DAMAGE TO ALEXANDRA SCHOOL BRUNSWICK ST.

BRICKWORK

Taking down 2 chimneys and rebuilding one	\$375.00
Pointing brickwork on walls and round windows doors, etc.	1800.00
Scaffolding	900.00
Taking down and rebuilding south wall out of plumb 2 1/2 inches, north wall out of plumb 1 in.	3600.00
Slating and copper flashing at eaves	1025.00
Composition roof	650.00

PLASTERING

Plastering 3320 sq. yds.	2422.00
Blackboards, moldings, etc.	2550.00

CARPENTER WORK

Roof frame, boarding, rep. to flat roof, cor- nice etc.	485.00
Sashes and repairs, parting slips, stops, transoms, sashes, etc.	658.00
New doors and repairs	366.00
Taking down, replacing and supporting ceilings in class rooms	570.00
Trusses and attic floor	250.00

PAINTING AND GLAZING

Glazing	759.00
Painting inside walls and outside sashes refinishing woodwork and 3 class room ceilings	2910.00

PLUMBING WORK

Plumbing work frozen W.C. tanks, valves, etc.	2000.00
Urinals, tanks and valves	300.00
Water and soil pipes, traps, etc.	850.00

HEATING

Radiators, valves, etc.	800.00
	<hr/> \$23670.00
.10%	2367.00
	<hr/> \$26037.00

(Sgd.) W. J. Busch

Feb. 5, 1918